

INSTALLATION INSTRUCTIONS INTERACTIVE PACK LOGS DL-IPL-NTC



Specifications:

- Material: Reinforced Crafted Concrete
- Approximate Size Assembly: 14'-7" x 7'-2" x 4'-11" Tall
- Approximate Weight: 5,500 lbs
- Maximum Fall Height: 3'-7" (assumes 12" of safety surfacing)

Required Parts (included):


- GFRC Sculpture
- Bolt Hangers (Lifting Eyes): 8ct
- "Interactive Pack Logs" Drawing Set

Recommended Equipment (not included):


- 10' Lifting Straps: 8ct
- Spreader Bar
- Lift: Reach Type Forklift or Skid Steer 8,000 lb Capacity
- 1/2" Quick Links: 8ct
- Wrench Set / Socket Set

Important Notes:

- *Warning: Installation over a hard surface such as asphalt, or packed earth may result in serious injury or death from falls.*
- *It is the responsibility of the installer to ensure all components are installed in compliance with ASTM F-1487.*
- *All site built footings should be allowed to cure for a minimum of 48 hours prior to installation.*

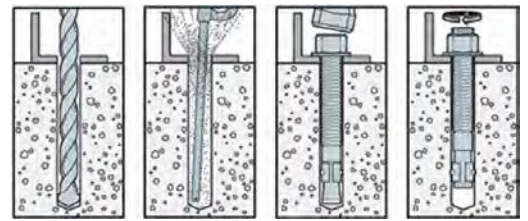

Typical Wedge Anchor Installation


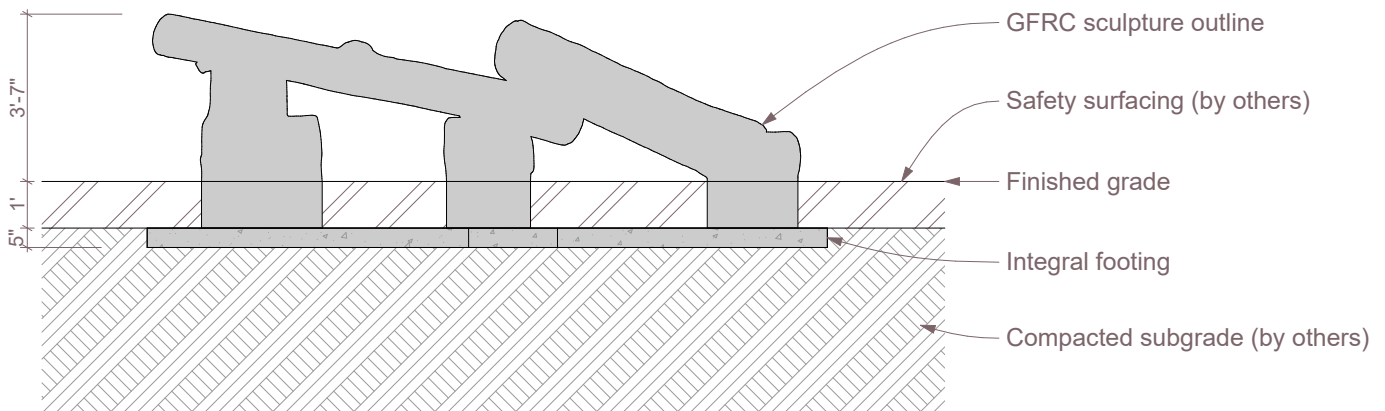


Section

PRE-INSTALL CHECKLIST

Please review prior to ordering and installing products.

- ☐ 1. Verify that you have the recommended lifting equipment to unload and install your component, as specified by the installation instructions. Please check the installation instructions for the weight of each component and shipping dimensions.
- ☐ 2. Develop a proper plan to access the site and control access prior to opening.
- ☐ 3. Call your local utilities to locate any potential existing below grade equipment?
- ☐ 4. FOR ALL SCULPTURES: Verify you have accounted for adjustments to the footing depth based on your choice of safety surfacing material. Footing depth must be adjusted to compensate for the depth/thickness requirements of the selected safety surfacing (*see diagrams below*). Layout drawings show the uninstalled dimensions of the component.

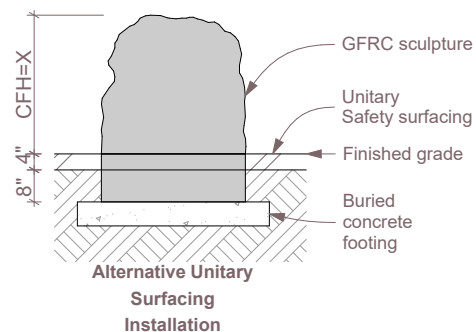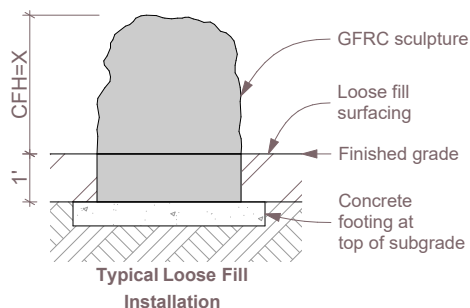

*Critical Fall Height (CFH)

- ☐ 5. Verify that you have installed any required footings prior to the arrival of your sculptures. Please note, footings should be allowed to cure for a minimum of 7 days.

Important Safety Note:


Please install and maintain adequate protective surfacing under and around equipment. Never let dogs play on the equipment before protective surfacing is installed.

INSTALLATION INSTRUCTIONS INTERACTIVE PACK LOGS DL-IPL-NTC




Sculpture Installation:

1. Excavate the site below the top of subgrade as per the provided layout drawings.
2. Compact the subgrade beneath the sculpture, level using sand as necessary.
3. Make sure that the bolt hanger / lifting eyes are securely attached to the bolts protruding from the sides of the integral footing. Secure the lifting straps to bolt hangers using 1/2" quick links.
4. Lift the sculpture using an appropriate reach forklift or crane taking care to equalize the load on straps.
5. Set the sculpture in place and verify layout and all use zones as required by ASTM 1487.
6. Remove bolt hangers.
7. Backfill so the subgrade is level with the top of the integral footing and compact as necessary.
8. Install resilient surfacing material in accordance with layout guidelines, and ASTM standards.

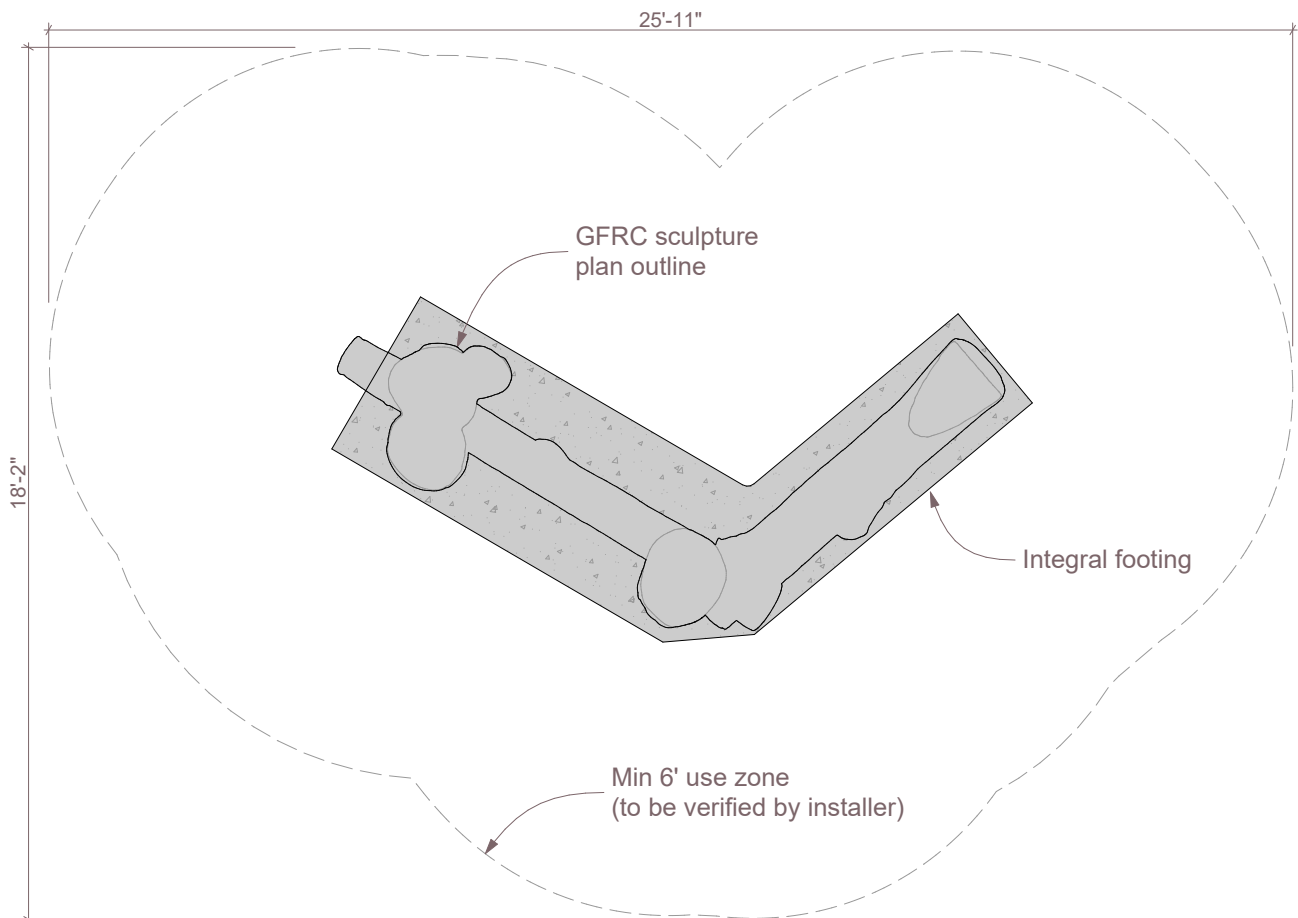


Plan

INSTALLATION INSTRUCTIONS
INTERACTIVE PACK LOGS
DL-IPL-NTC

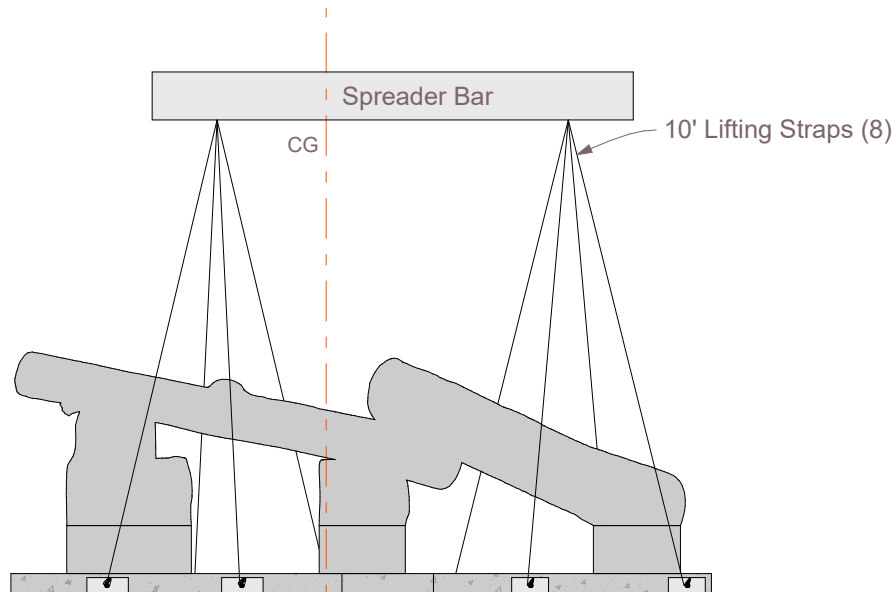

Pick Diagram - Section

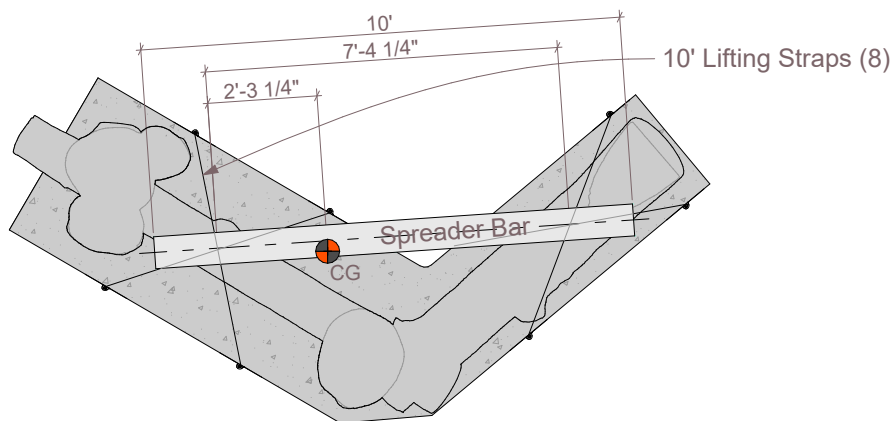

Pick Diagram - Plan